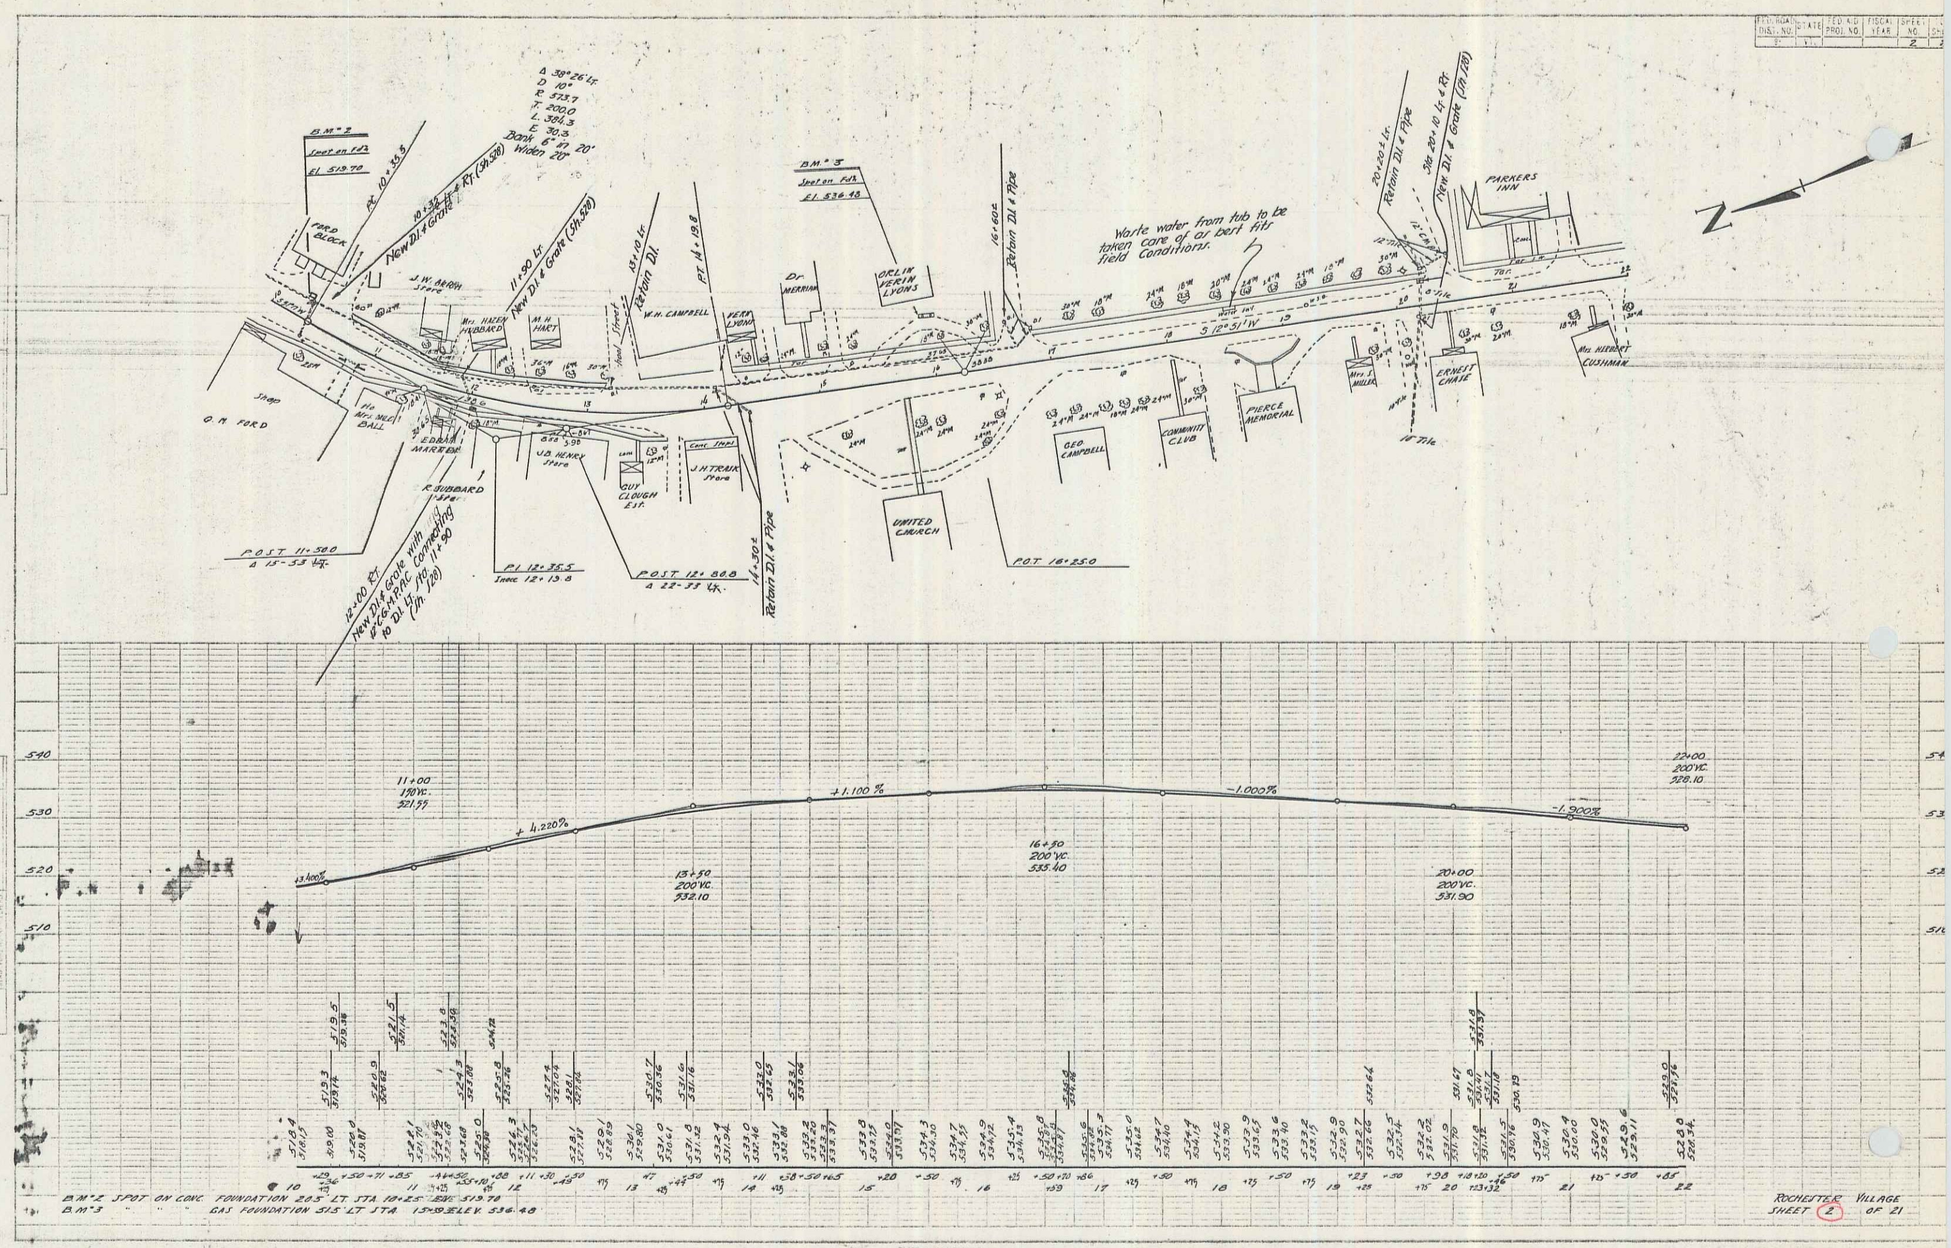
Δ 39°26' Lt.
D 10°
R 573.7
T 200.0
L 394.3
E 30.3
Bank 6:1
Widen 20'
B.M.# 2
Spot on Hyd.
El 519.70
Ford Block
Rt. 10+35.5
New Dit. & Grade (Sh. 5&6)
J.W. Arrish Store
Mrs. Hazen Hubbard
M.H. Hart
W.H. Campbell
Dr. Merrian
Orlin Verin Lyons
B.M.# 3
Spot on Hyd.
El 536.48
Return Dit.
Pit 14+18.8
Pit 14+18.8 Lt.
16" Bore
Return Dit. & Pipe
Waste water from tub to be taken care of as best fits field conditions.
S 72°-31' W
Parkers Inn
Ernest Chase
Mrs. Herbert Cushman
Pierce Memorial
Community Club
Geo. Campbell
United Church
J.H. Travis Store
Gus Clough Est.
U.D. Henry Store
Edward Marrone
R. Hubbard Store
Mrs. Mel Ball
O.M. Ford
Shop
POST 11+50.0
Δ 15°-53' Lt.
PI 12+35.5
Intersec. 12+13.8
POST 12+80.8
Δ 22°-33' Lt.
POST 16+25.0
12+00 Rt.
New Dit. & Grade with 16" Cast Iron connecting to Dit. Lt. (Sh. 1&2)
11+00
190' VC.
521.77
+4.220%
13+50
200' VC.
531.10
+1.100%
16+50
200' VC.
535.40
-1.000%
20+00
200' VC.
531.90
-1.900%
22+00
200' VC.
528.10
+3.400%
540
530
520
510
BM #2 SPOT ON CONC. FOUNDATION 20.5' LT. STA. 10+25 ELEV. 519.70
BM #3 " " " CAS FOUNDATION 51.5' LT. STA. 13+50 ELEV. 536.48
ROCHESTER VILLAGE
SHEET 2 OF 21

2