FED. ROAD DIST. NO.	STATE	FED. AID PROJECT NO.	SHEET NO.	TOTAL SHEETS
9	VT.	FR 5 D 1924	9	48

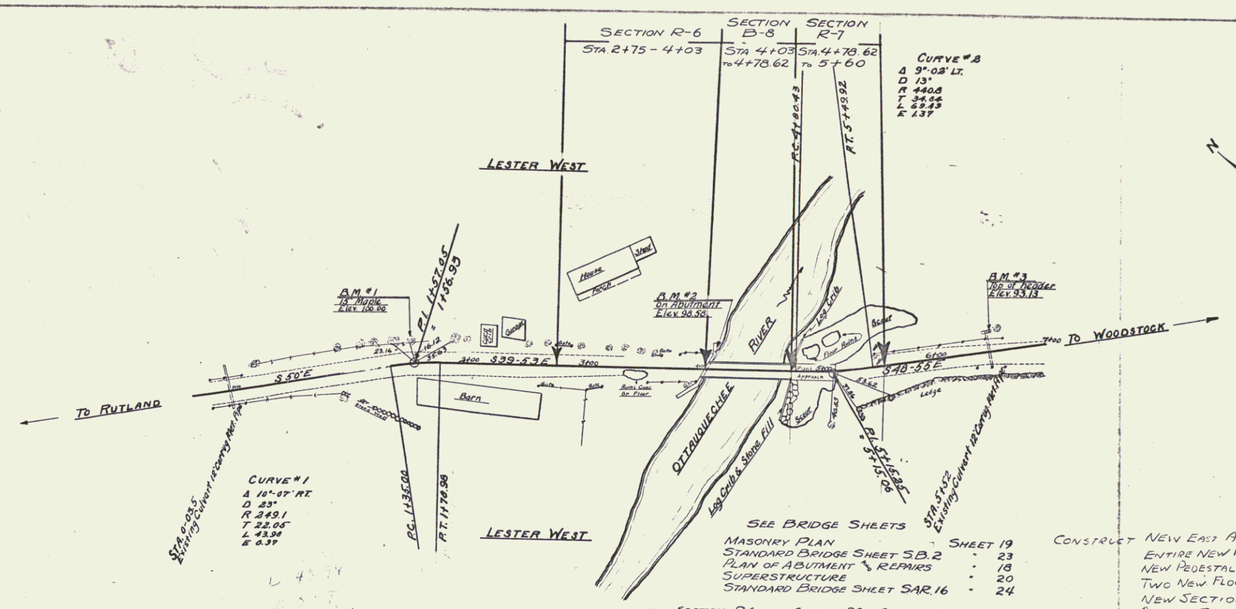

WOOD GUARD RAIL REQUIRED
ON LEFT
STA. 4+78.5 - STA. 6+30.5 L=152'
ON RIGHT
STA. 4+78.5 - STA. 5+18.5 L=40'
TOTAL LENGTH

SEE BRIDGE SHEETS

MASONRY PLAN	SHEET	19
STANDARD BRIDGE SHEET SB.2	"	23
PLAN OF ABUTMENT & REPAIRS	"	18
SUPERSTRUCTURE	"	20
STANDARD BRIDGE SHEET SAR.16	"	24

CONSTRUCT NEW EAST ABUTMENT
ENTIRE NEW FLOOR SLAB
NEW PEDESTAL ON DOWNSTREAM END OF WEST ABUTMENT
TWO NEW FLOOR BEAMS
NEW SECTION OF BOTTOM CHORD
OTHER STEEL REPAIRS AS NEEDED.
PAINT INSIDE UPPER CHORDS

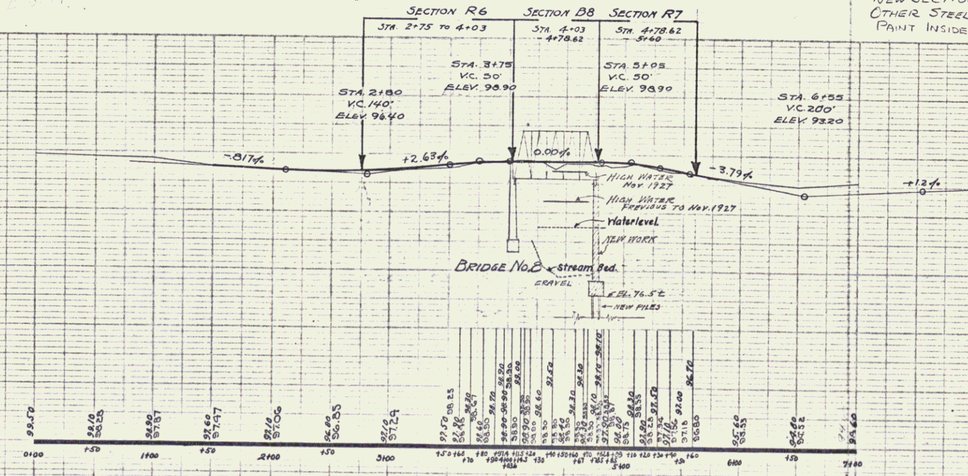

SECTIONS R-6, R-7, B-8.

B.M. #1 Spike in 15" Maple, 18' Lt. Sta. 1+55. Elev. 100.00
B.M. #2 N.E. cor. of N.W. abutment. Elev. 98.58
B.M. #3 Top of east header, culvert at Sta. 5+52. Elev. 93.13

SERIES FR No. 5 D
SHEET 9 OF 48

7