


Riv. St. Trav. 84+95Lt ~85+20Lt
Remove & Reset Guard Rail

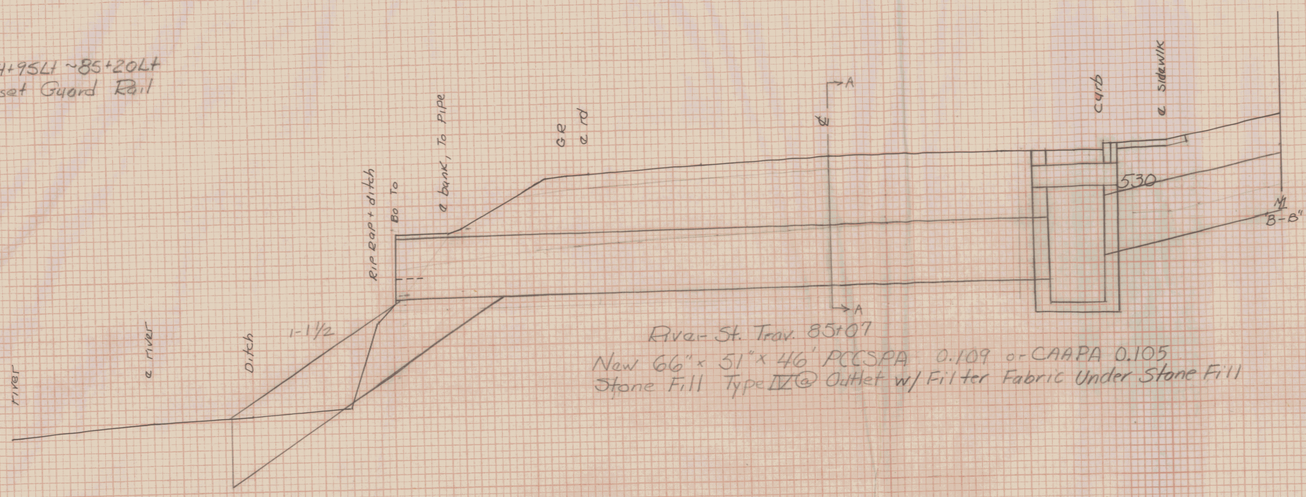

River St. Trav. 85+07
New 66" x 51" x 46' PCCSPA 0.109 or CAAPA 0.105
Stone Fill Type IV @ Outlet w/ Filter Fabric Under Stone Fill

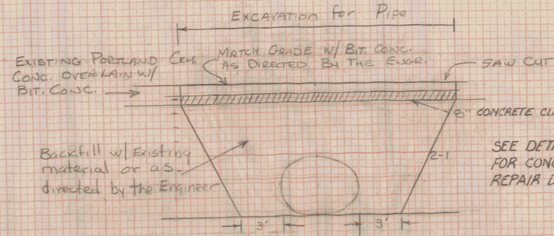


SEE DETAIL BELOW FOR CONCRETE PAVEMENT REPAIR DETAIL

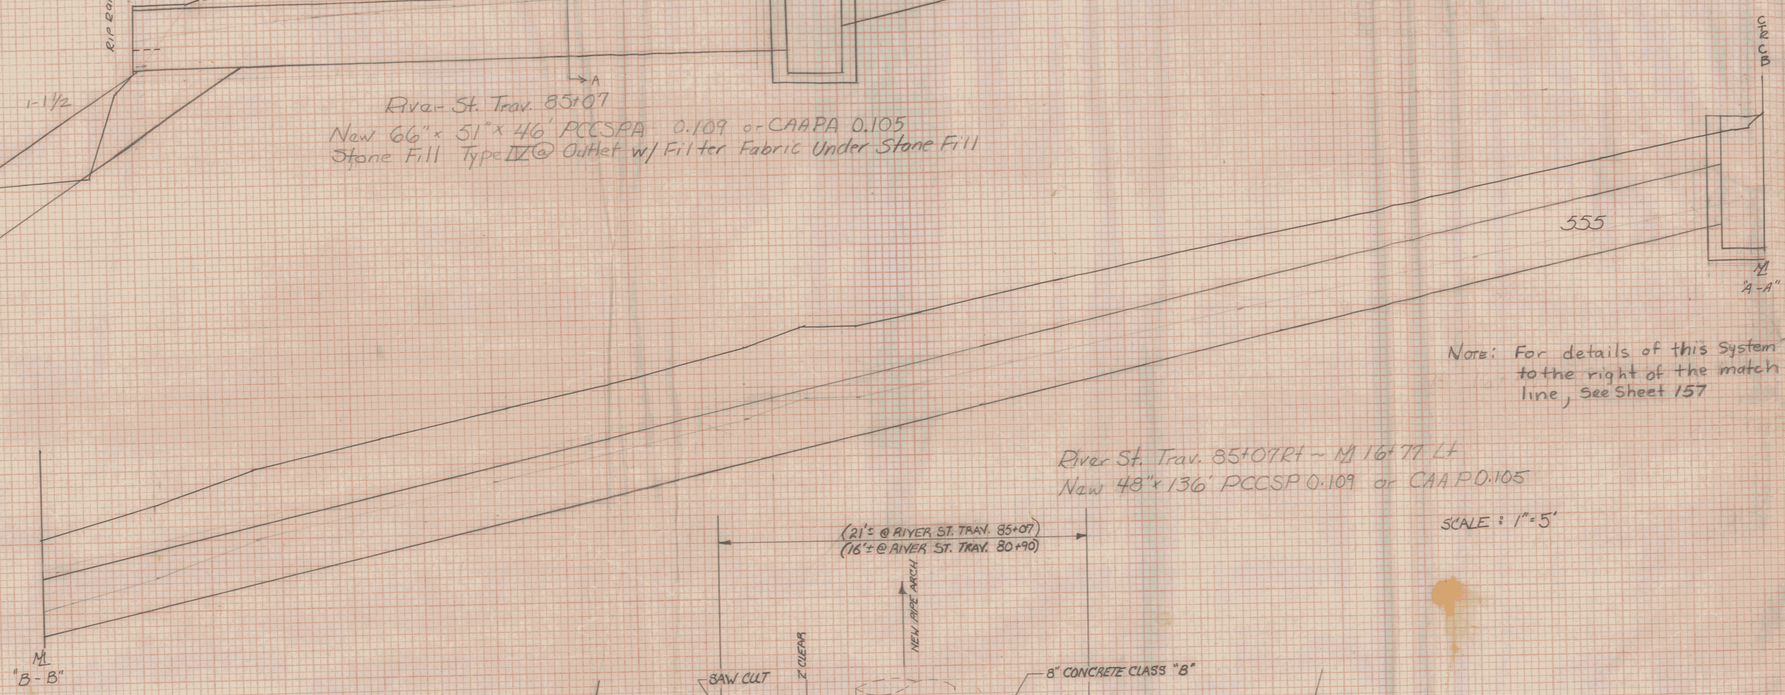

Note: For details of this System to the right of the match line, See Sheet 157

River St. Trav. 85+07Rt ~ M 16+77 Lt
New 48" x 136' PCCSP 0.109 or CAA P0.105

SCALE: 1" = 5'

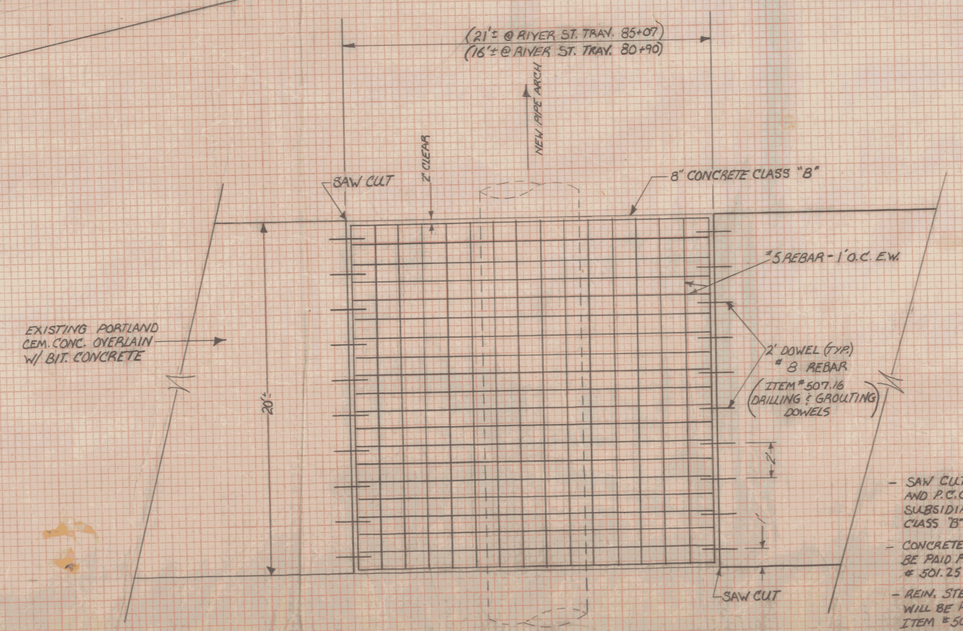

P.C.C. PAVEMENT REPAIR DETAIL
NTS

- SAW CUTTING OF BIT. ASPHALT AND P.C.C. PAVE. WILL BE SUBSIDIARY TO CONCRETE CLASS "B" ITEM # 501.25
- CONCRETE FOR REPAIR WILL BE PAID FOR UNDER ITEM # 501.25 CONC. CL. "B"
- REIN. STEEL USED IN REPAIR WILL BE PAID FOR UNDER ITEM # 507.15 REIN. STEEL

MONTPELIER
M EGC-M 6400(7)
SHEET 158 OF 335