

Stone Fill For Slope
 Protection (Light Type),
 Item 512
 NB 2567+00 ~ 2571+00 RT
 SB 2569+50 ~ 2570+00 RT
 SB 2571+00 ~ 2575+00 LT

Three Cable Guard Rail
 w/ Lt. Steel Posts
 Item 538
 NB 2563+52 ~ 2572+00 RT
 SB

Treated Timber Curb,
 Item 558
 NB 2563+00 ~ 2570+00 LT

Plank Guard Rail,
 Item 540
 NB 2566+45 RT, 16 LF
 NB 2571+30 RT, 24 LF
 SB 2570+10 LT, 52 LF

Demolition and Disposal
 of Building,
 Item 586
 SB 2575+15 RT


Standard Steel Beam Guard Rail
 w/ Steel Posts (6'-3" Spacing)
 Item 549-A
 NB 2568+98 ~ 2575+00 LT
 SB 2564+98 ~ 2575+00 RT
 SB 2564+98 ~ 2575+00 LT

Drilling and Blasting
 of Solid Rock Subgrade Item 115
 NB 2559+00 ~ 2563+00
 NB 2572+75 ~ 2575+00
 SB 2561+00 ~ 2563+75

CONSTRUCT U-TURN
 2563+00 NB, LT

PROPERTY LINE FENCE
 WITH STEEL POSTS
 ITEM 583-2 MOD.

STA.	STA.	POS.
2559+00	2575+00	RT.
2561+00	2575+00	LT.

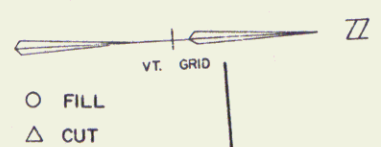

RELOC T-57
 CURVE DATA

Δ	66° 45' 00"
D	12° 00' 00"
R	47.746'
T	314.53'
L	556.25'
E	94.29'
Bank	1/2" Per Ft.

STAGE 1 CONSTRUCTION
 BROOKFIELD - WILLIAMSTOWN
 BERLIN
 I 89-1 (11)(29)
 CONTRACT No. 3
 SHEET 44 OF 403
 122 265

PORTER, COHEN & ARNOLD
 CONSULTING ENGINEERS NEWARK, N.J.