
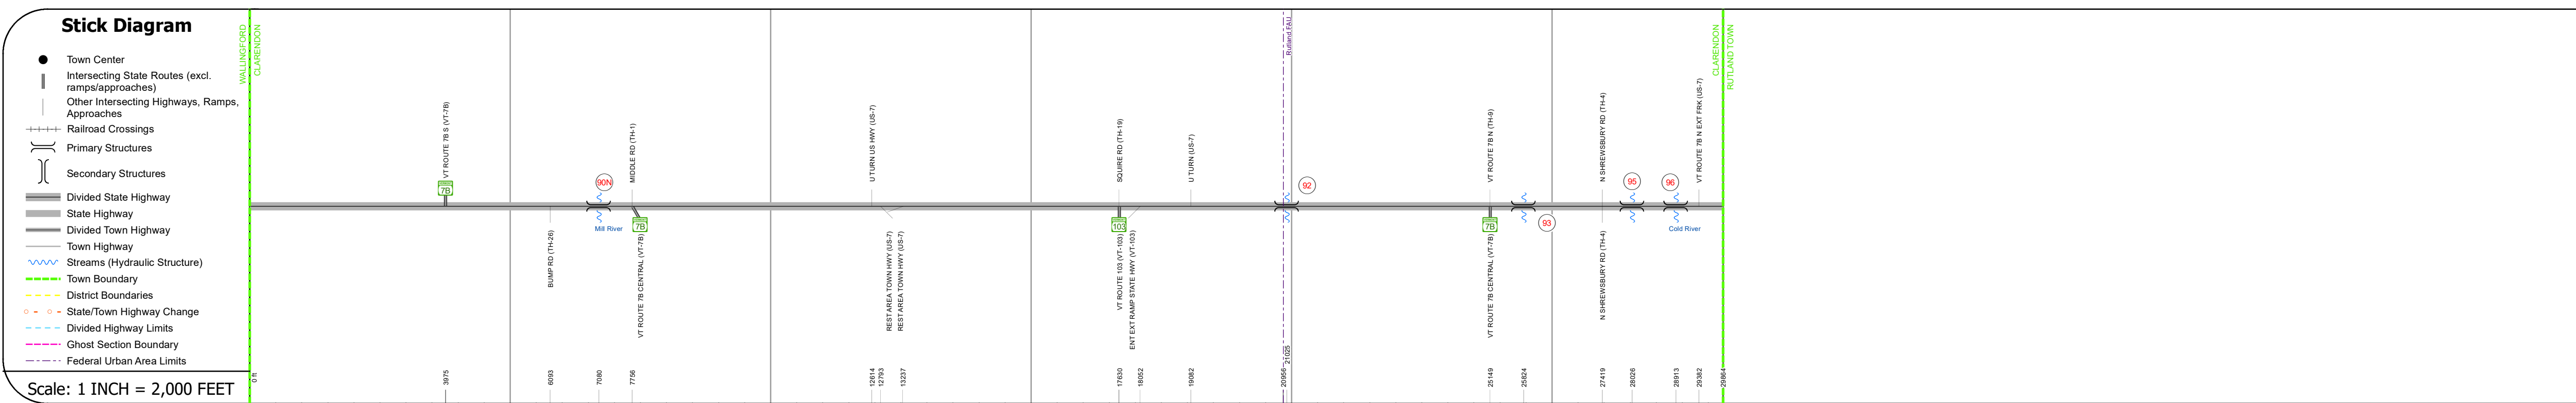


DISTRICT	TOWN	ROUTE
3	CLARENDON	US-7

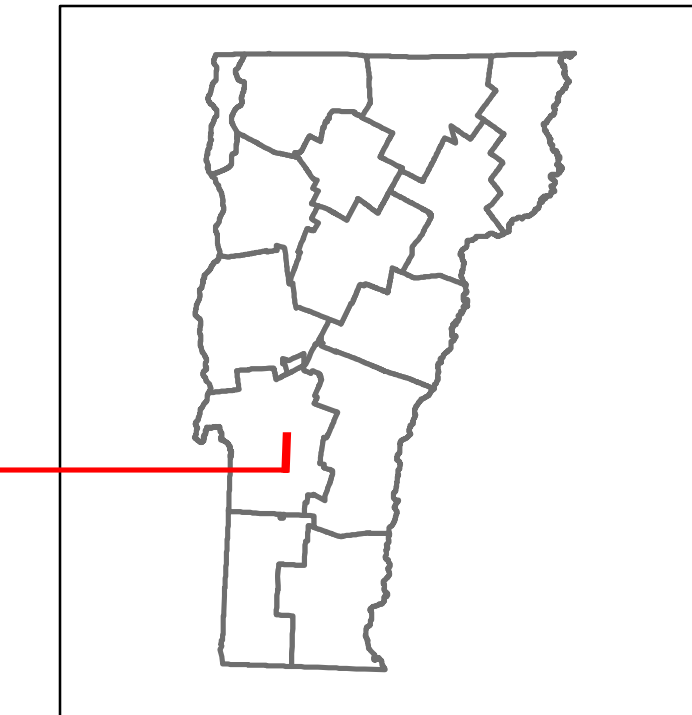

Scale: 1 INCH = 2,000 FEET	0	1	2	3	4	5
Travellane	24	24	24	24	24	24
Roadway	38	49	38	38	38	38
Lane Count	3	3	3	3	3	3
Base	5" Crushed Gravel Base Course					
Subbase	24" Crushed Gravel					

Curves	Grades	Guardrails	Rumblestrips
	+3.3		
	-3.9		

Historic Projects
2016 NH SURF(10)
2006 NH 2207(1)S
1986 F DECK(16)S
2005 NH3 SGNL(24)
1984 F 019-2(16)
1987 AP 019-3(2)
1987 F 019-3(7)
1988 AP 019-3(8)
1988 F DECK(16)S

Maintenance Garage
District 3 - DMF Maintenance Clarendon Garage

Speed Zone
55

Functional Class
3

National Highway System
NHS - Other NHS Routes

Limited Access Highway
Partial

Customer Service Level
Arterial Highway

Traffic Counters					
R106	R105	311051/SR715-N	R027	R463	31131105725-N

ADT	2022	2021	2020	2019	2018
R106	7077	7021	6197	7317	7300
R105	6312	6262	5527	6525	7400
311051/SR715-N	6587	6535	6017	7104	7100
R027	11632	11540	10618	12536	12500
R463	11653	12030	10317	12536	12500
31131105725-N	11671	11567	10576	12850	13000
Other	12343	12233	11008	13376	13500
Total	12542	12516	11165	13566	14900

Crash Locations	
(Incomplete) 2023	
2022	
2021	
2020	
2019	

STRUCTURE DESCRIPTIONS

Bridge 90N:
Stringer/multi-beam or girder - 1967
Structure No: 200019090N11052
Length: 311'
Height: 100.0'
Width: 30.0'
Weight Limit: 0
Facility Carried: US 07 ML
Structure Type: 4 SPAN ROLLED BEAM
Features Intersected: MILL RIVER
Surface: Bituminous
Inspection Date: 5/2023
Maintenance/Ownership: State

Bridge 92:
Culvert - 1967
Structure No: 300019009211051
Length: 12'
Under Clearance: 12.0'
Weight Limit: 0
Facility Carried: US7
Structure Type: CGMPP
Features Intersected: BROOK
Inspection Date: 12/2020
Maintenance: State

Bridge 93:
Culvert - 1968
Structure No: 300019009311051
Length: 7'
Under Clearance: 6.0'
Weight Limit: 0
Facility Carried: US7
Structure Type: CGMPA
Features Intersected: CATTLE PASS
Inspection Date: 12/2020
Maintenance: State

Bridge 95:
Culvert - 1968
Structure No: 300019009511051
Length: 19'
Under Clearance: 7.0'
Weight Limit: 0
Facility Carried: US7
Structure Type: CGMPA
Features Intersected: BROOK
Inspection Date: 12/2020
Maintenance: State

Bridge 96:
Stringer/multi-beam or girder - 1968
Structure No: 200019009611052
Length: 132'
Height: 100.0'
Width: 70.0'
Weight Limit: 0
Facility Carried: US 07 ML
Structure Type: WELDED PLATE GIRDER
Features Intersected: COLD RIVER
Surface: Bituminous
Inspection Date: 5/2023
Maintenance/Ownership: State

Historic Projects <ul style="list-style-type: none"> Unknown Retreatment Resurface Bituminous Mix Skippy Mix Bituminous Seal 	Functional Class <ul style="list-style-type: none"> 1 - Interstate System 2 - Other 3 - Principal Arterial 4 - Minor Arterial 5 - Major Collector 6 - Minor Collector 	Curves <ul style="list-style-type: none"> Left (degrees) Right (degrees) 	Grades <ul style="list-style-type: none"> special grade up special grade down 	Traffic Counters <ul style="list-style-type: none"> Continuous (CTC) Weight-In-Motion (WIM) Short-Term, Scheduled Short-Term, Unscheduled 	Crash Locations <ul style="list-style-type: none"> Fatal Injury Property Damage Only Unknown Crash Type 	Mileage by Functional Class By Sheet 019-3 3 - Other Principal Arterial 019-2 3 - Other Principal Arterial 2.317 3.339	Mileage by Town By Sheet CLARENDON - U007-1105 5.656 of 5.656	DISTRICT 3	TOWN CLARENDON	Date: 09/27/23	ROUTE US-7 ETE mileage: 57.828 to 63.484
Page Total Mileage: 5.656 mi							Page Total Mileage: 5.656 mi				