


LIMITS OF WORK		
STA 276+12 - 281+35	LT	
STA 279+17 - 281+11	RT	
STA 281+48 - 282+03	RT	
STA 281+63 - 282+03	LT	
ITEM 653.60 - EROSION LOG		
STA 280+09 - 281+35	LT	
STA 281+48 - 282+03	RT	
STA 281+63 - 282+03	LT	

LEGEND	
EXISTING EDGE OF PAVEMENT	-----
EXISTING CULVERT	=====
EXISTING STONE WALL	-----x-----
EXISTING FENCE	x-----x-----
EXISTING TREE LINE	-----o-----
EXISTING TREES	-----o-----
WETLAND BOUNDARY	-----w-----
TOE OF SLOPE	-----o-----
TOE OF CUT	-----o-----
EXISTING RIGHT OF WAY	-----
EXISTING SIDELINES	-----
PROJECT DEMARCATION FENCE	PDF---PDF---
EROSION LOG	-----*-----
TEMPORARY INLET PROTECTION	-----
EROSION MATTING	-----
STONE FILL	-----
CULVERT FLOW DIRECTION	----->-----

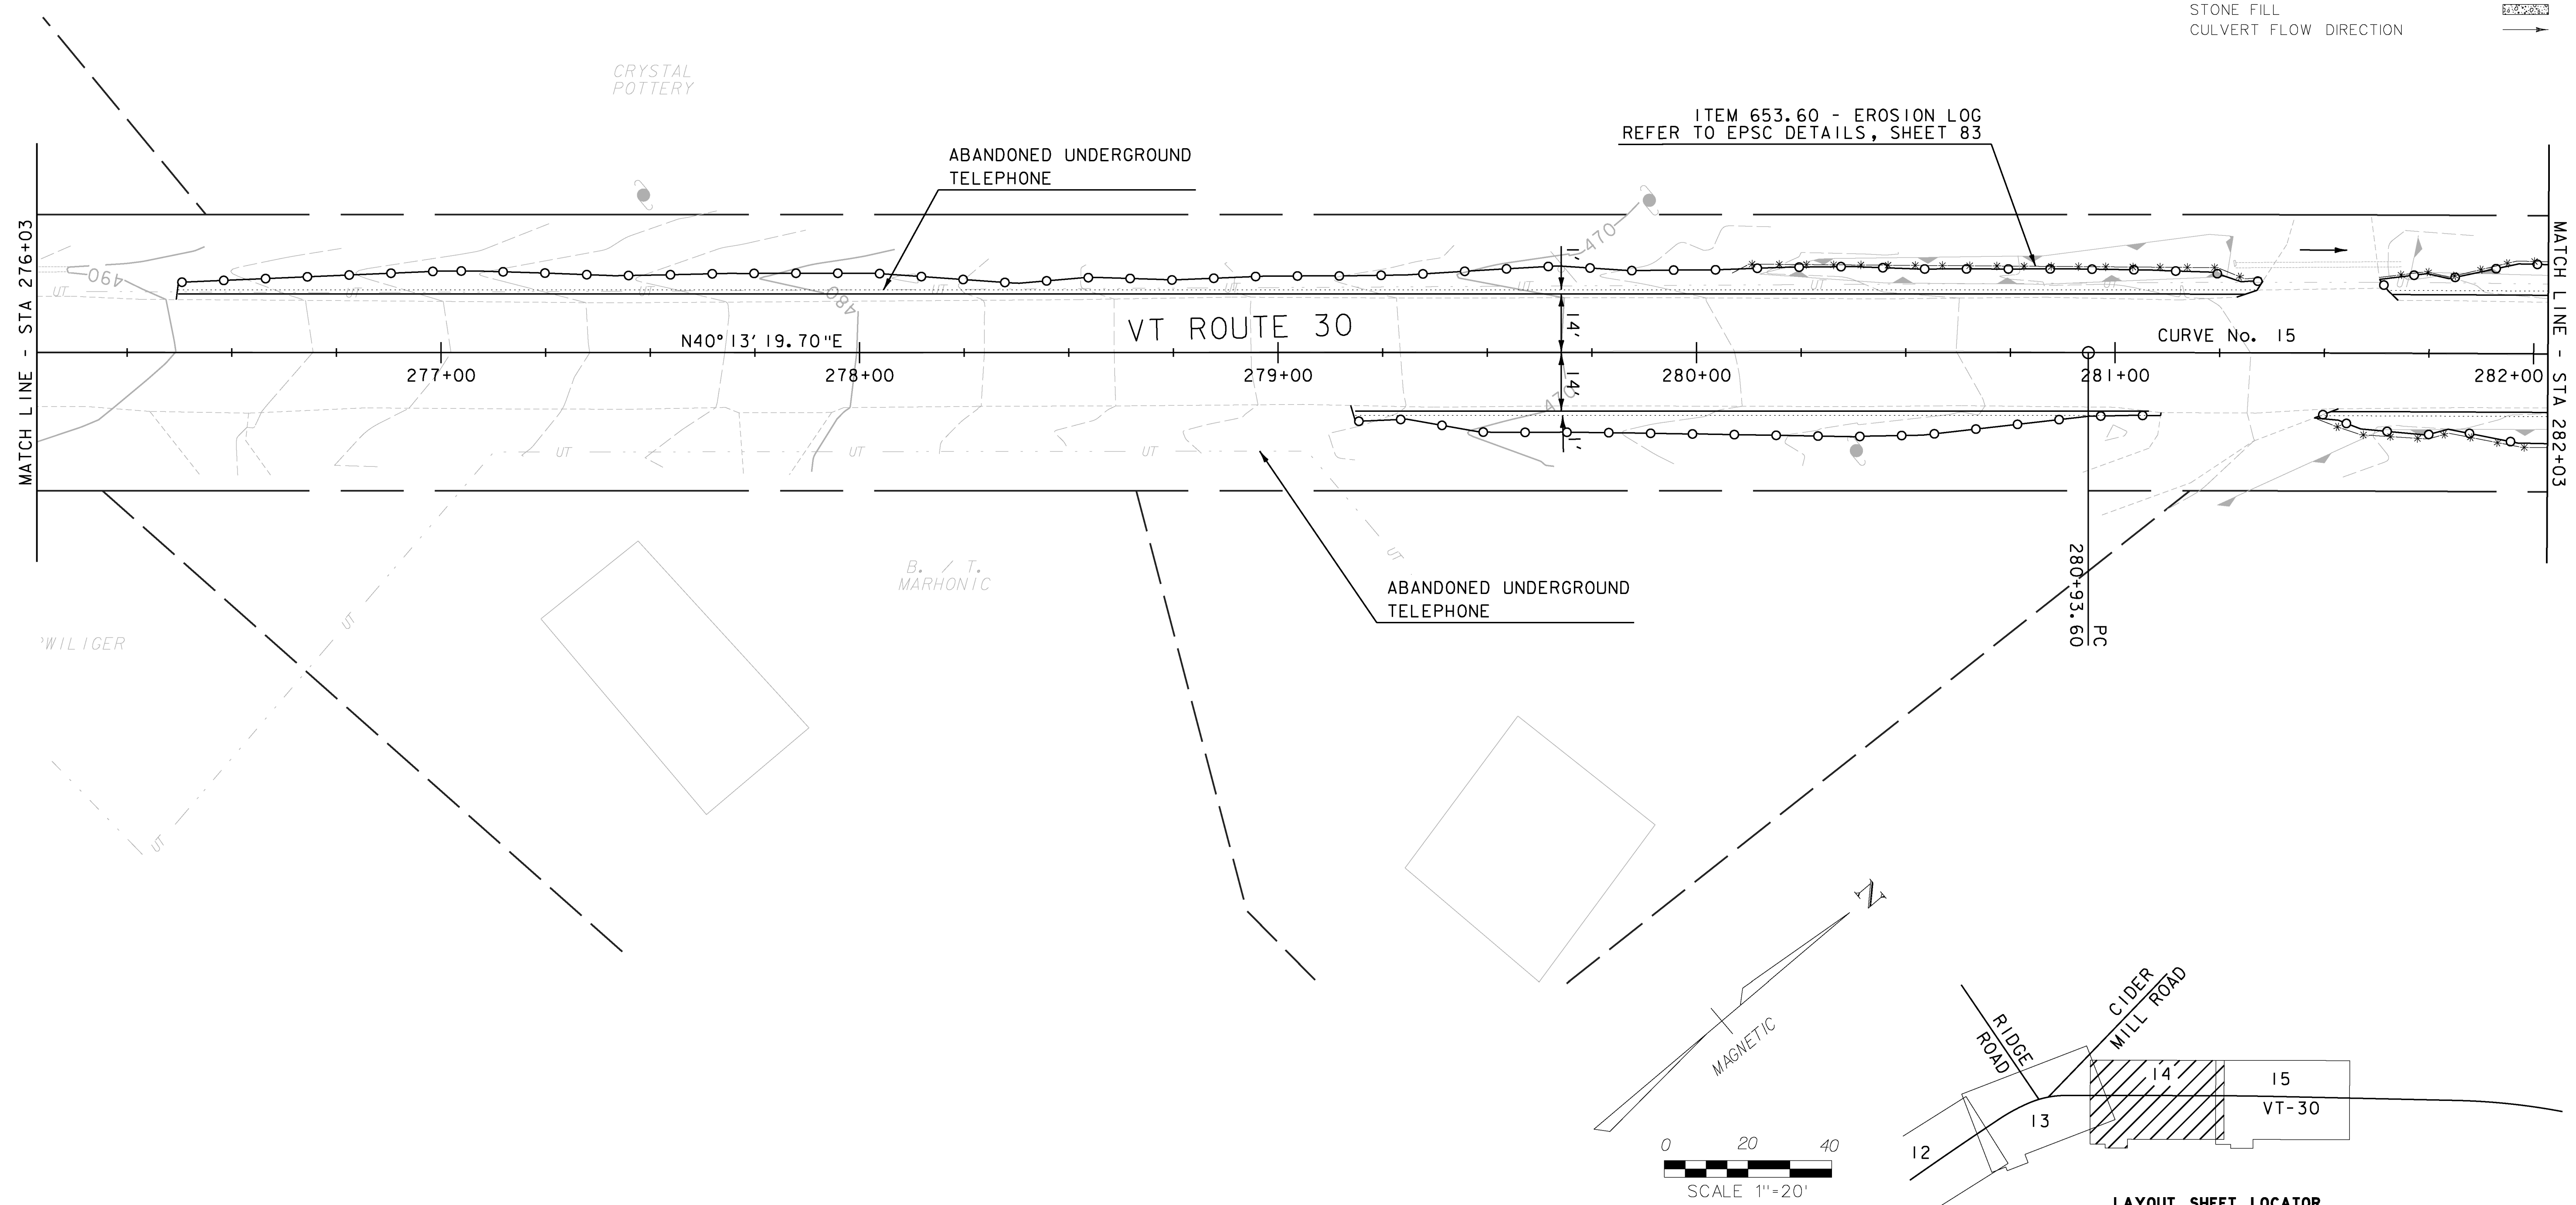


CURVE No. 15 DATA  
 $\Delta = 1^\circ 10' 27''$  RT  
 $R = 20000$  FT  
 $T = 204.96$  FT  
 $L = 409.90$  FT  
 $E = 1.05$  FT  
 $D = 0^\circ 17' 11''$

NO.	DATE	REVISIONS	BY	CK'D

DATUM  
 VERTICAL NAVD 88  
 HORIZONTAL NAD 83

**R S G INC.**  
 RESOURCE SYSTEMS GROUP, INC.  
 60 Lake Street, Unit 1E • Burlington, Vermont 05401  
 TEL 802.383.0118 • FAX 802.383.0122 • www.rsginc.com

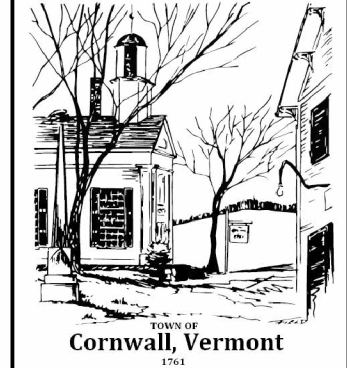

PROJECT NAME: CORNWALL - MIDDLEBURY  
 PROJECT NUMBER: STP EH08(13)  
 FILE NAME: Z08F122BDR NU.DGN  
 PROJECT LEADER: MS  
 DESIGNED BY: CM  
 LAYOUT SHEET 14  
 PLOT DATE: 06/09/2010  
 DRAWN BY: CM  
 CHECKED BY: MS  
 SHEET 71 OF 133