



1872
TOWN
LATTICE

NO
LOITERING

SPEED LIMIT
HORSES AT A WALK
MOTOR VEHICLES
10 MILES PER HR.















































1

FT & IN
INCHES

2

39 FT

3

4

Lat


OVERHEIGHT VEHICLE IMPACT DAMAGE TO CROSS BRACING



DISLODGED CROSS BRACE CONNECTION





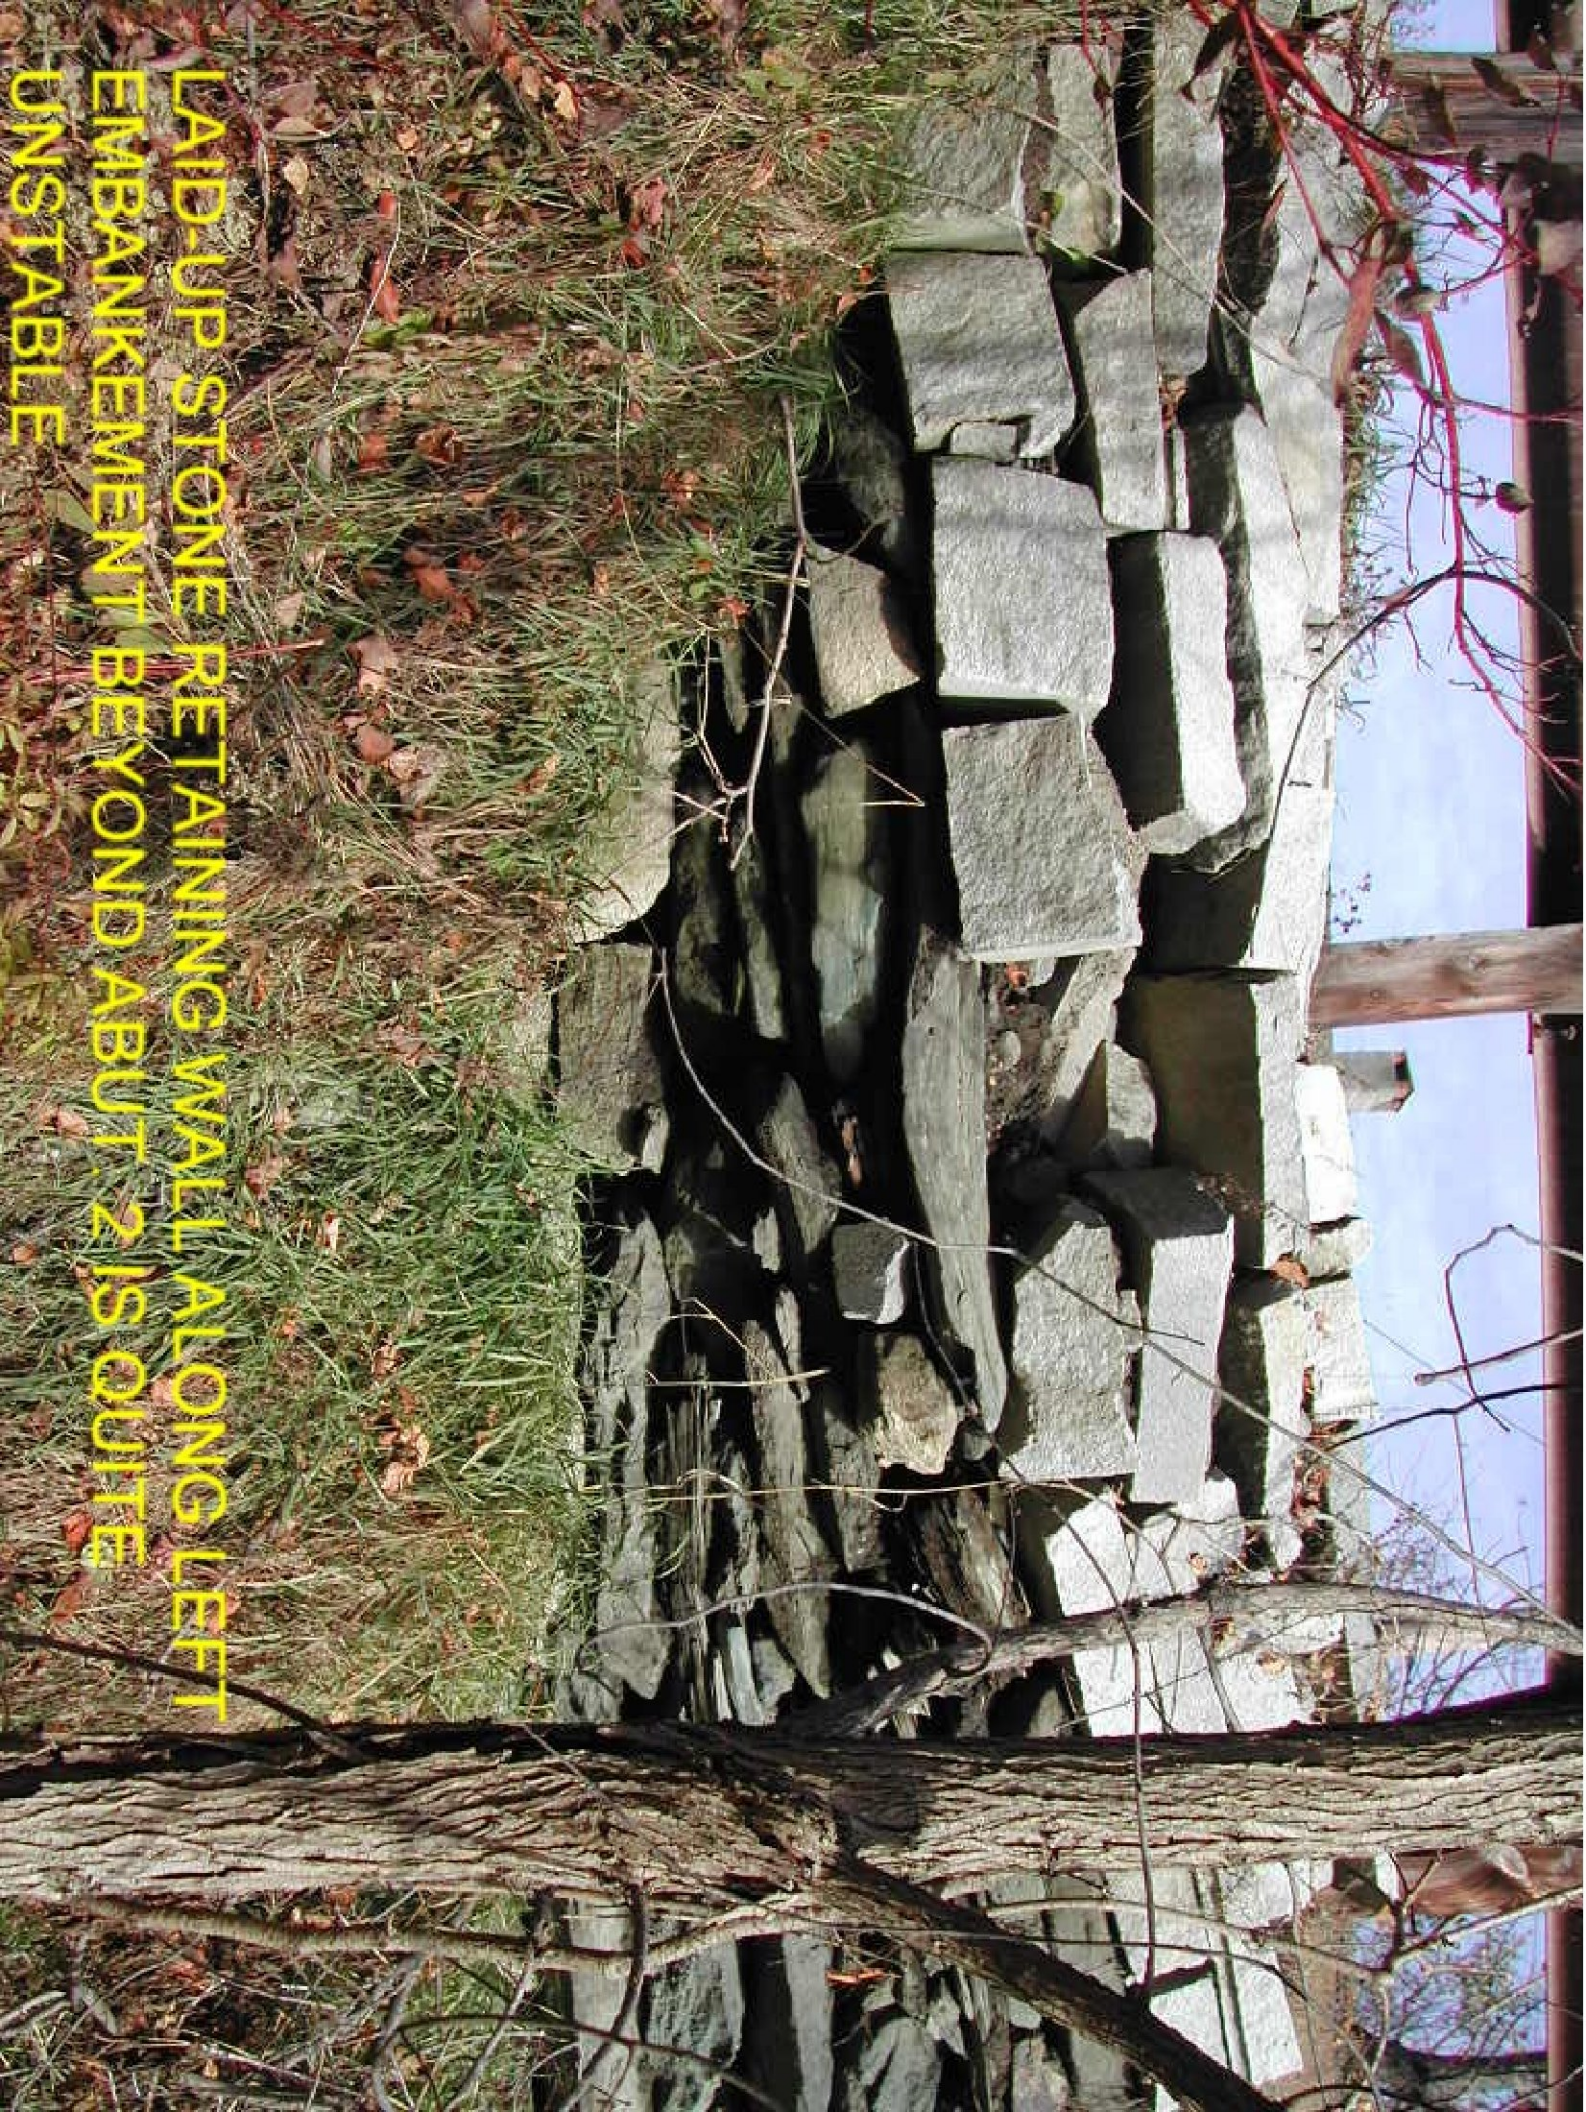

LAID-UP STONE RETAINING WALL ALONG LEFT
EMBANKMENT BEYOND ABOUT 2 IS QUITE
UNSTABLE





















POPOUT ALONG PIER SEAT BELOW BM. 2 ON WEST SIDE
BEARING UNDERMINED APPROX. 30%





