

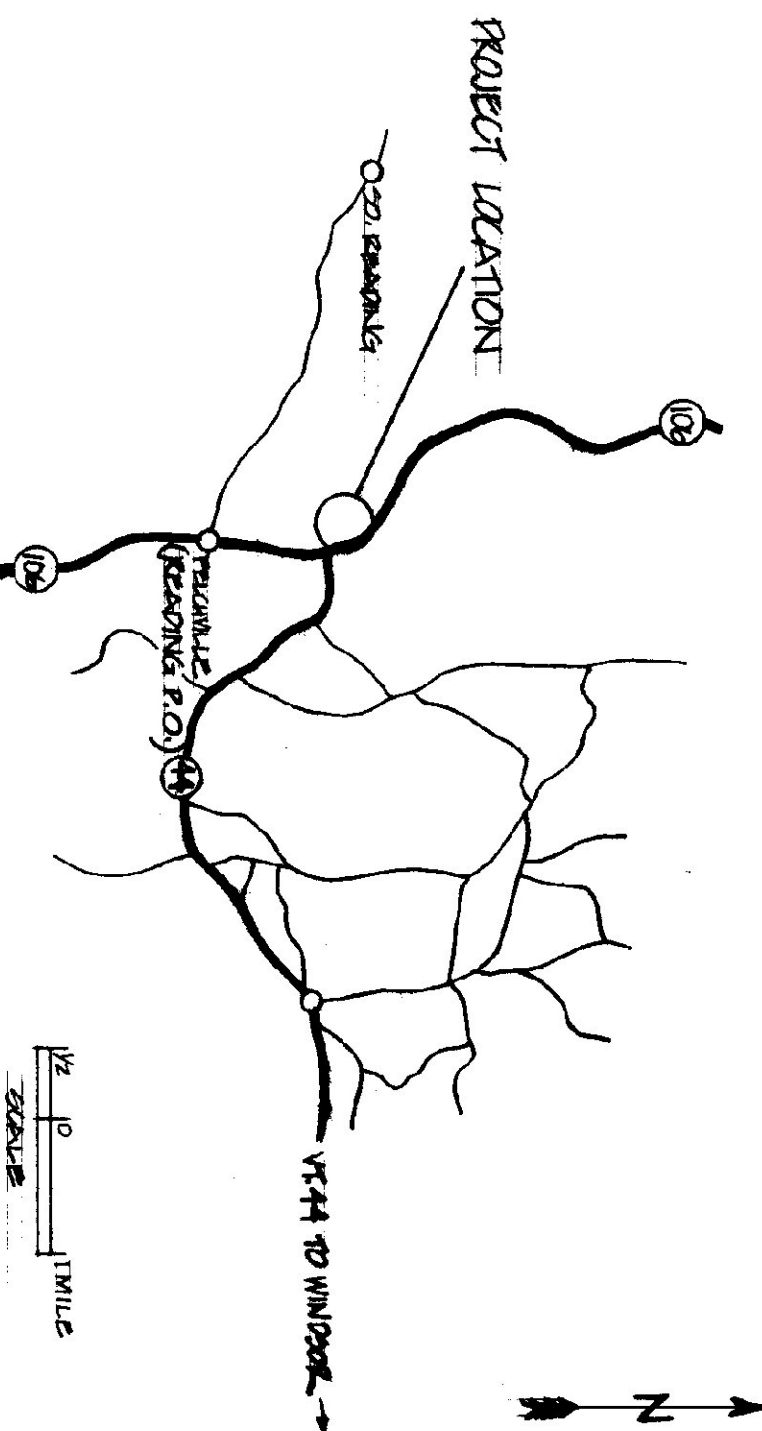
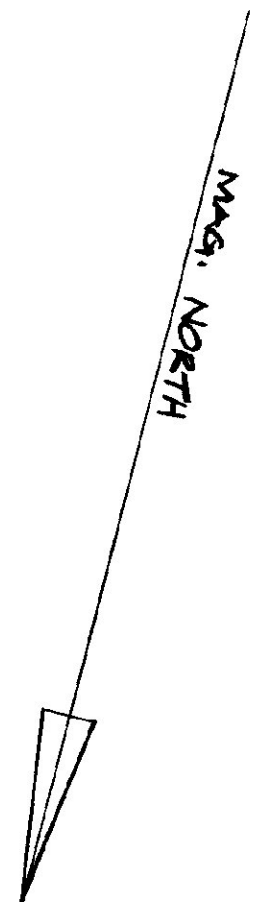


TEST PIT LOG

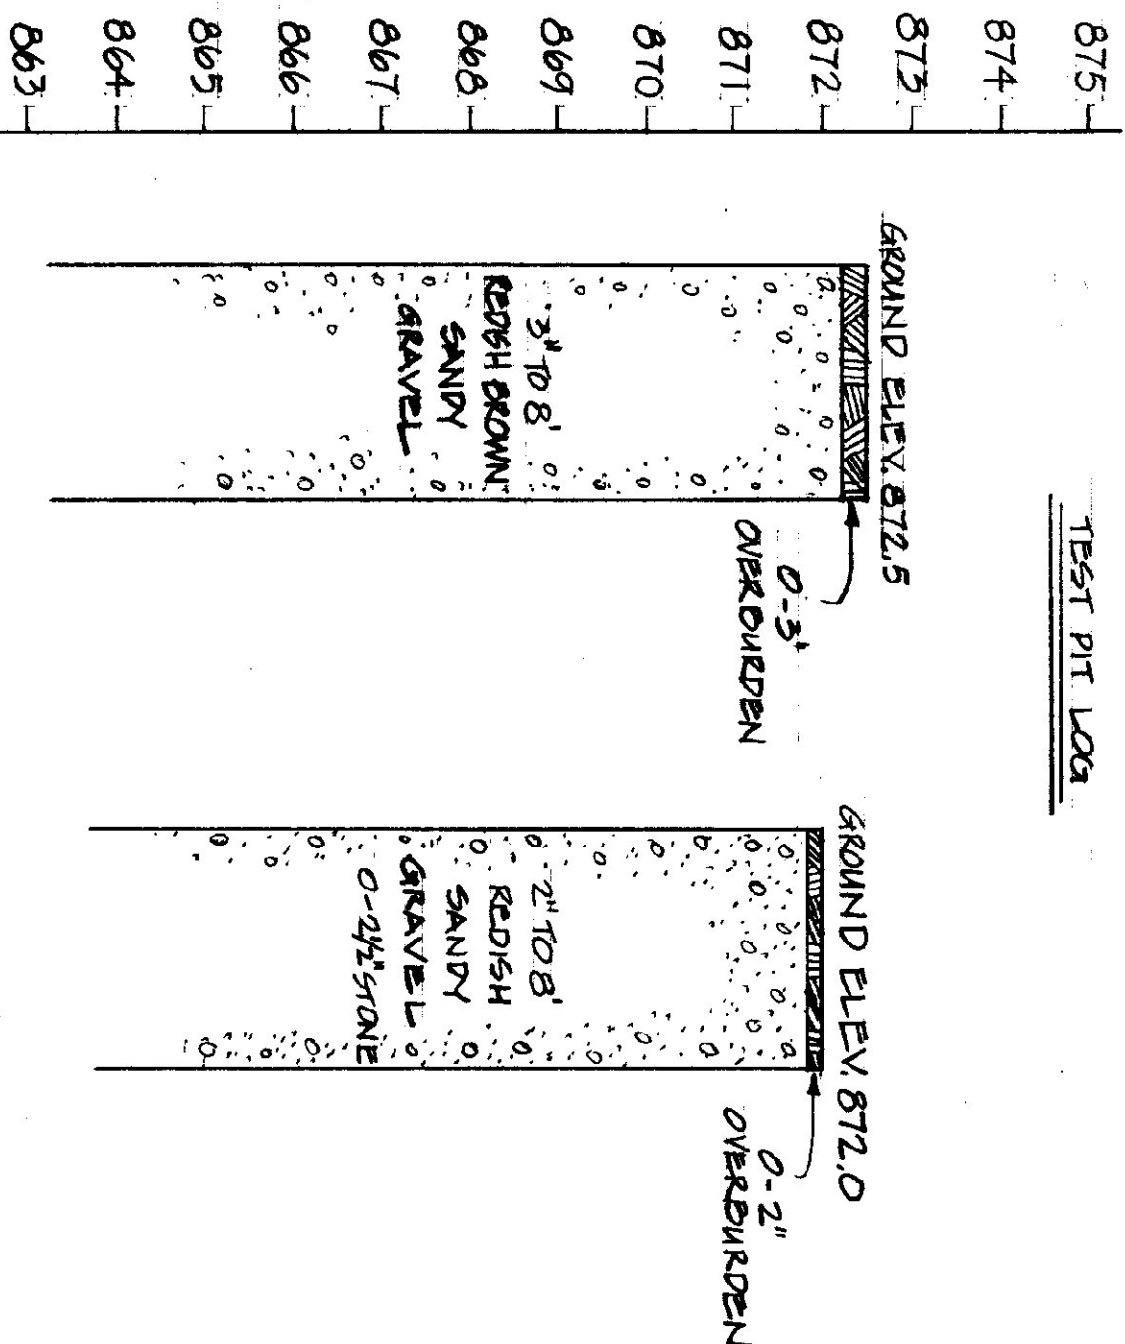


NOTE:
LAND IS GENERALLY
FLAT IN THIS AREA (<5% SLOPE)


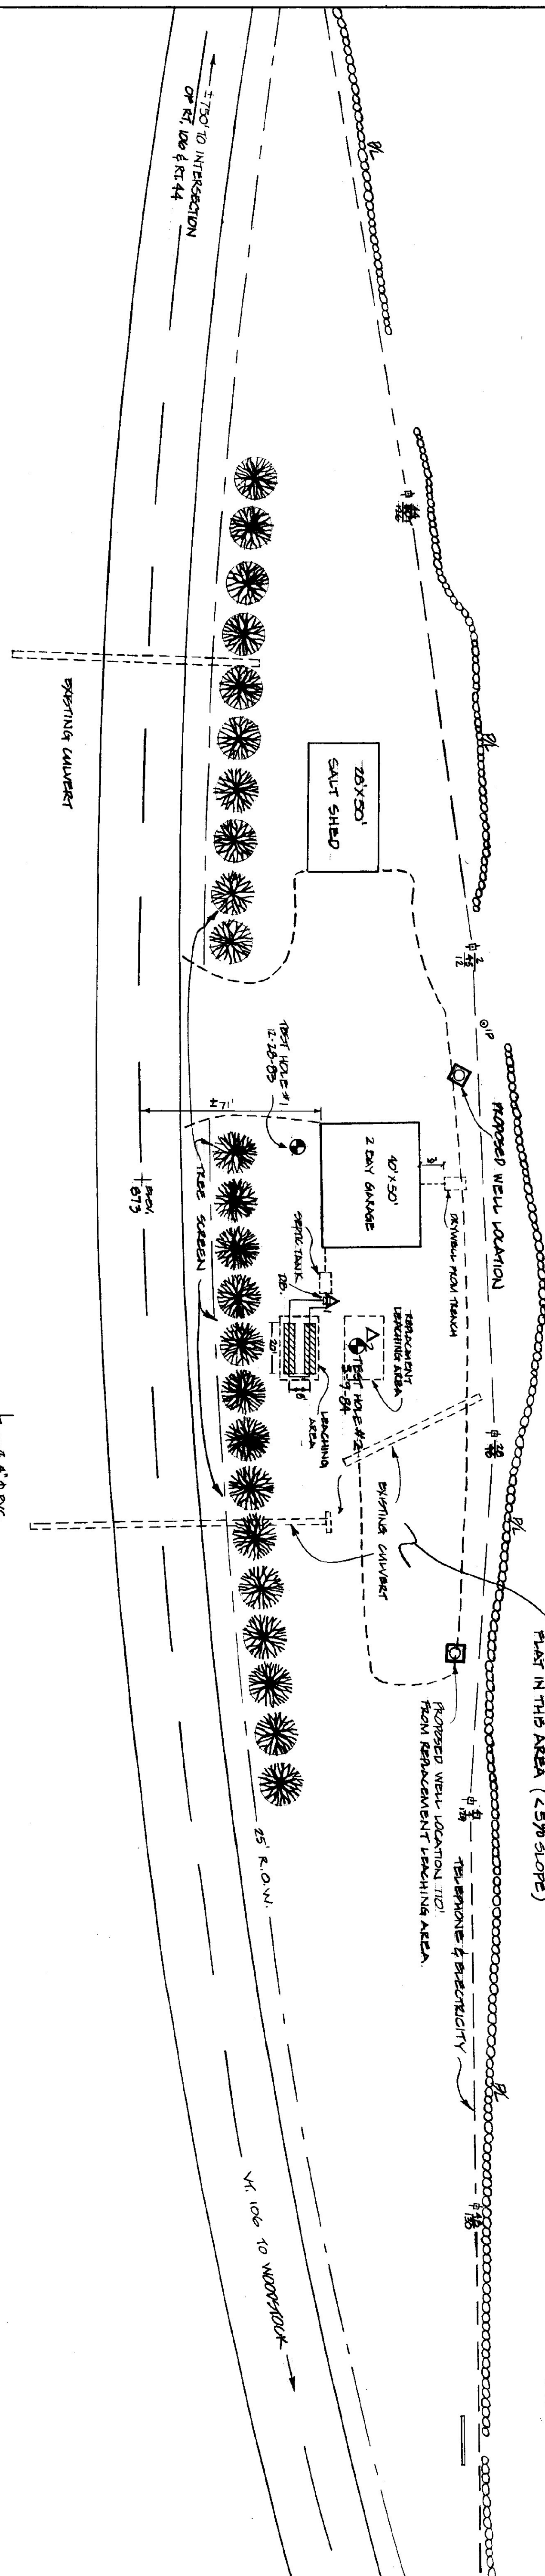


SEPTIC SYSTEM DESIGN INFORMATION

- 2 EMPLOYEES FULL TIME
- MINIMUM DESIGN FLOW 150 GPD
- PERCOLATION TESTED:
- P1 - 1 MIN/INCH
- P2 - 2 1/2 MIN/INCH (DESIGN)
- APPLICATION RATE 1.5 GAL/FT²/DAY
- FACTOR OF SAFETY 1.20
- SOIL BORING (6' DEPTH)
- PERCOLATION TEST HOLE (36" DEPTH) 4/24/04
- PERCOLATION TEST HOLE (30" DEPTH)

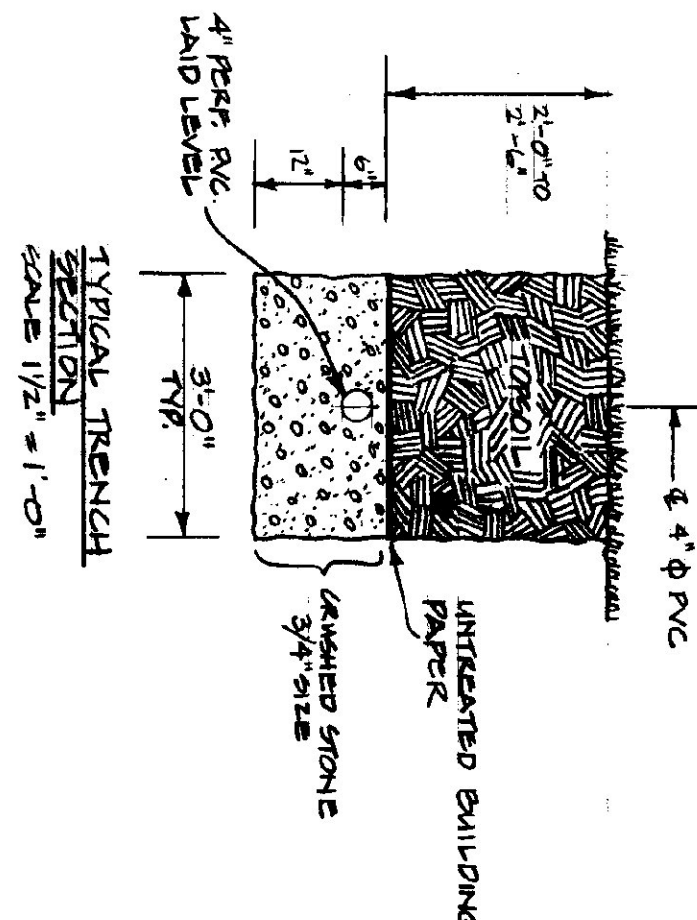

DRYWELL SECTION

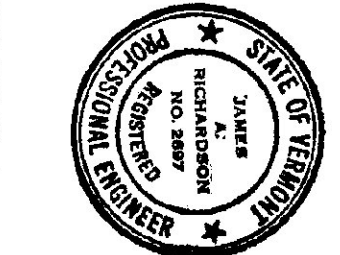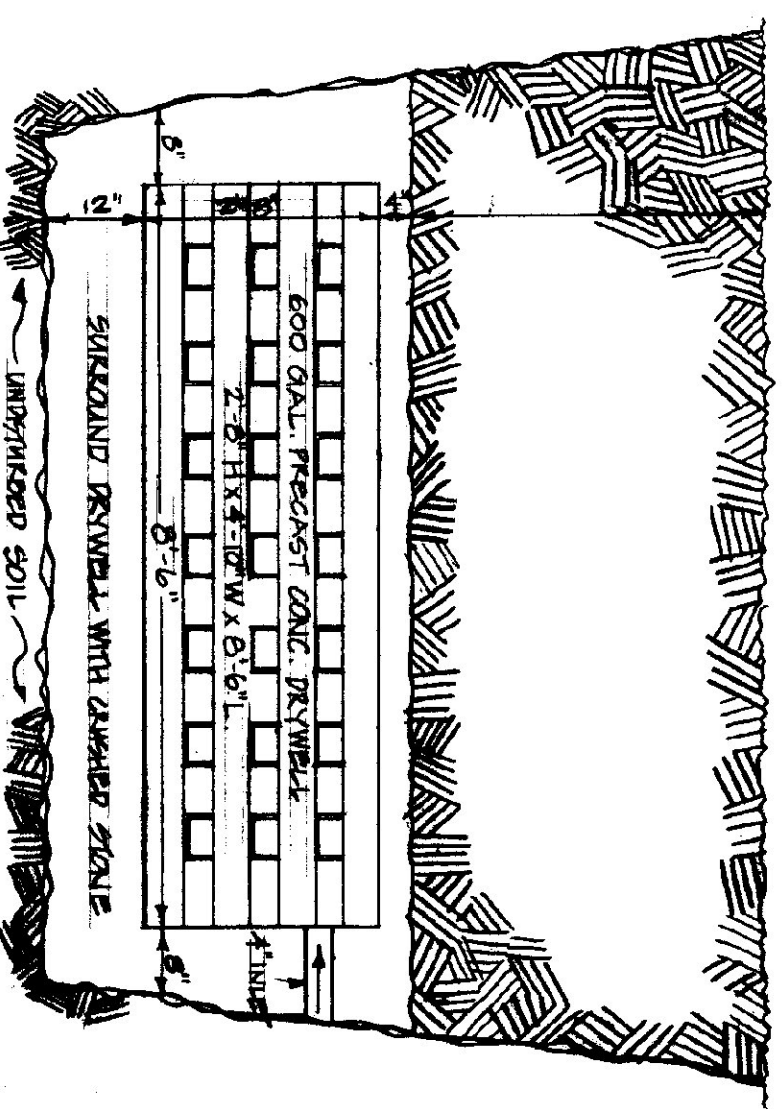

STATE OF VERMONT			
DIVISION OF STATE BUILDINGS			
AGENCY OF ADMINISTRATION			
MONTPELIER, VERMONT			
AGENCY OF TRANSPORTATION			
TWO DAY GARAGE			
READING, VERMONT - DISTRICT 4			
SITE PLAN			
DATE JANUARY 1984	SCALE 1"=50'	REVISIONS	DWG. NO.
DRAWN BY: A. BULLIN	APPROVED BY: F. RATT	DATE 5/1/84	1 OF 1